

TEMPORARY PRODUCTION DEVIATION

Document Number 211 (REV 2)

Date 1/9/02

Products Affected

Cut in Date

Cut in S/N

150M AM

All units shipped after 1/15/03

Deviation Description

Reduces noise 6-8 db and improves sonics

Delete qty 2 of p/n 53560201 CAP., 560pF $\pm 2.5\%$ 630V (C97,98) for a new total of 0

Add qty 2 of p/n 53330201 CAP., 330pF $\pm 2.5\%$ 630V (C97,98) for a new total of 2
Add OFHC jumper solder side per print

Do foil cut and move R40 (1.5K) to ground per print

Expected Effectivity of Deviation


Until ECN is released

Sign Offs



Copies


Rich, Carol, Sandy, Jane, Pat, QA, The, Chris, Leonard

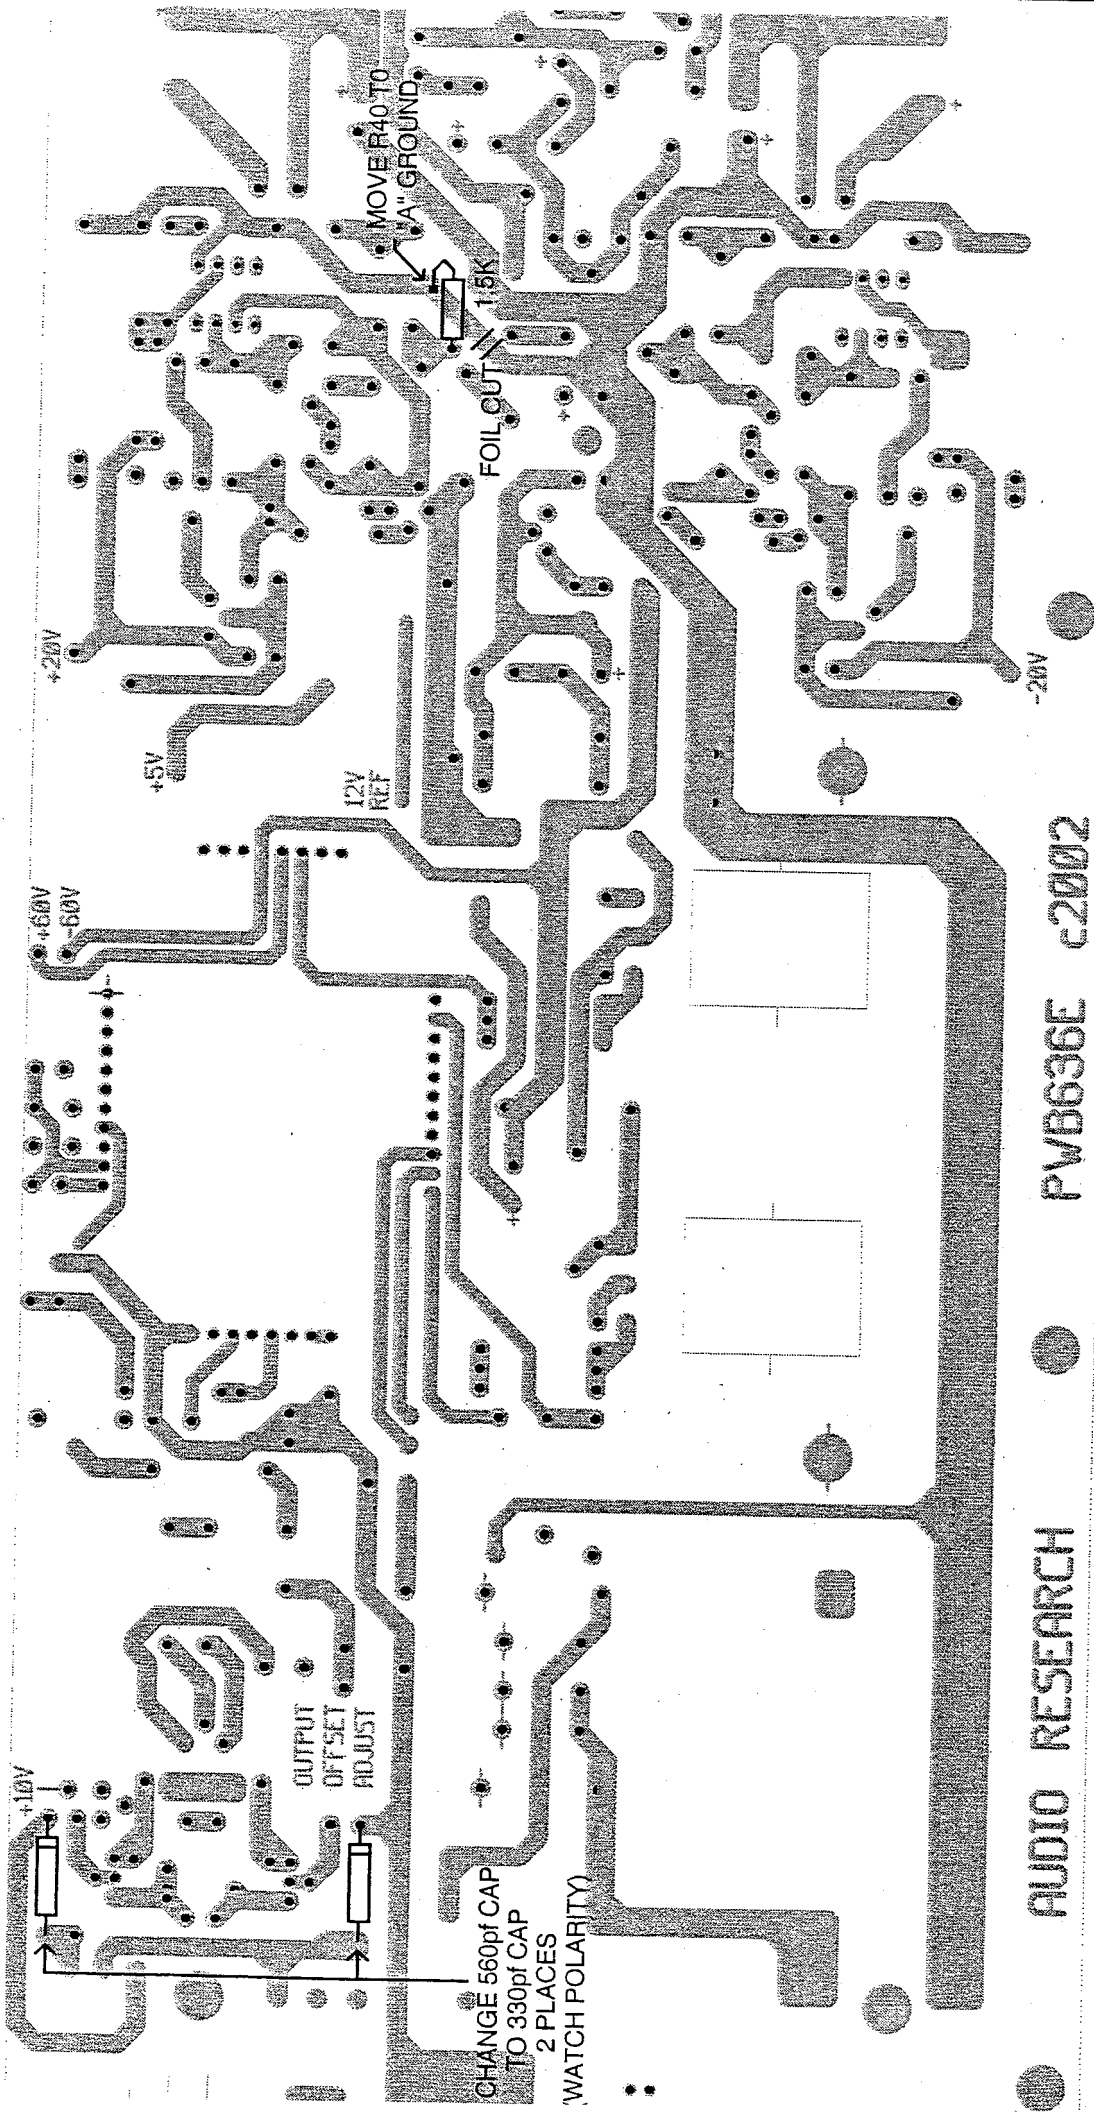

AUDIO RESEARCH

PWB636E c2002

150M REV2
PWB636E COMPONENT SIDE
1-8-03

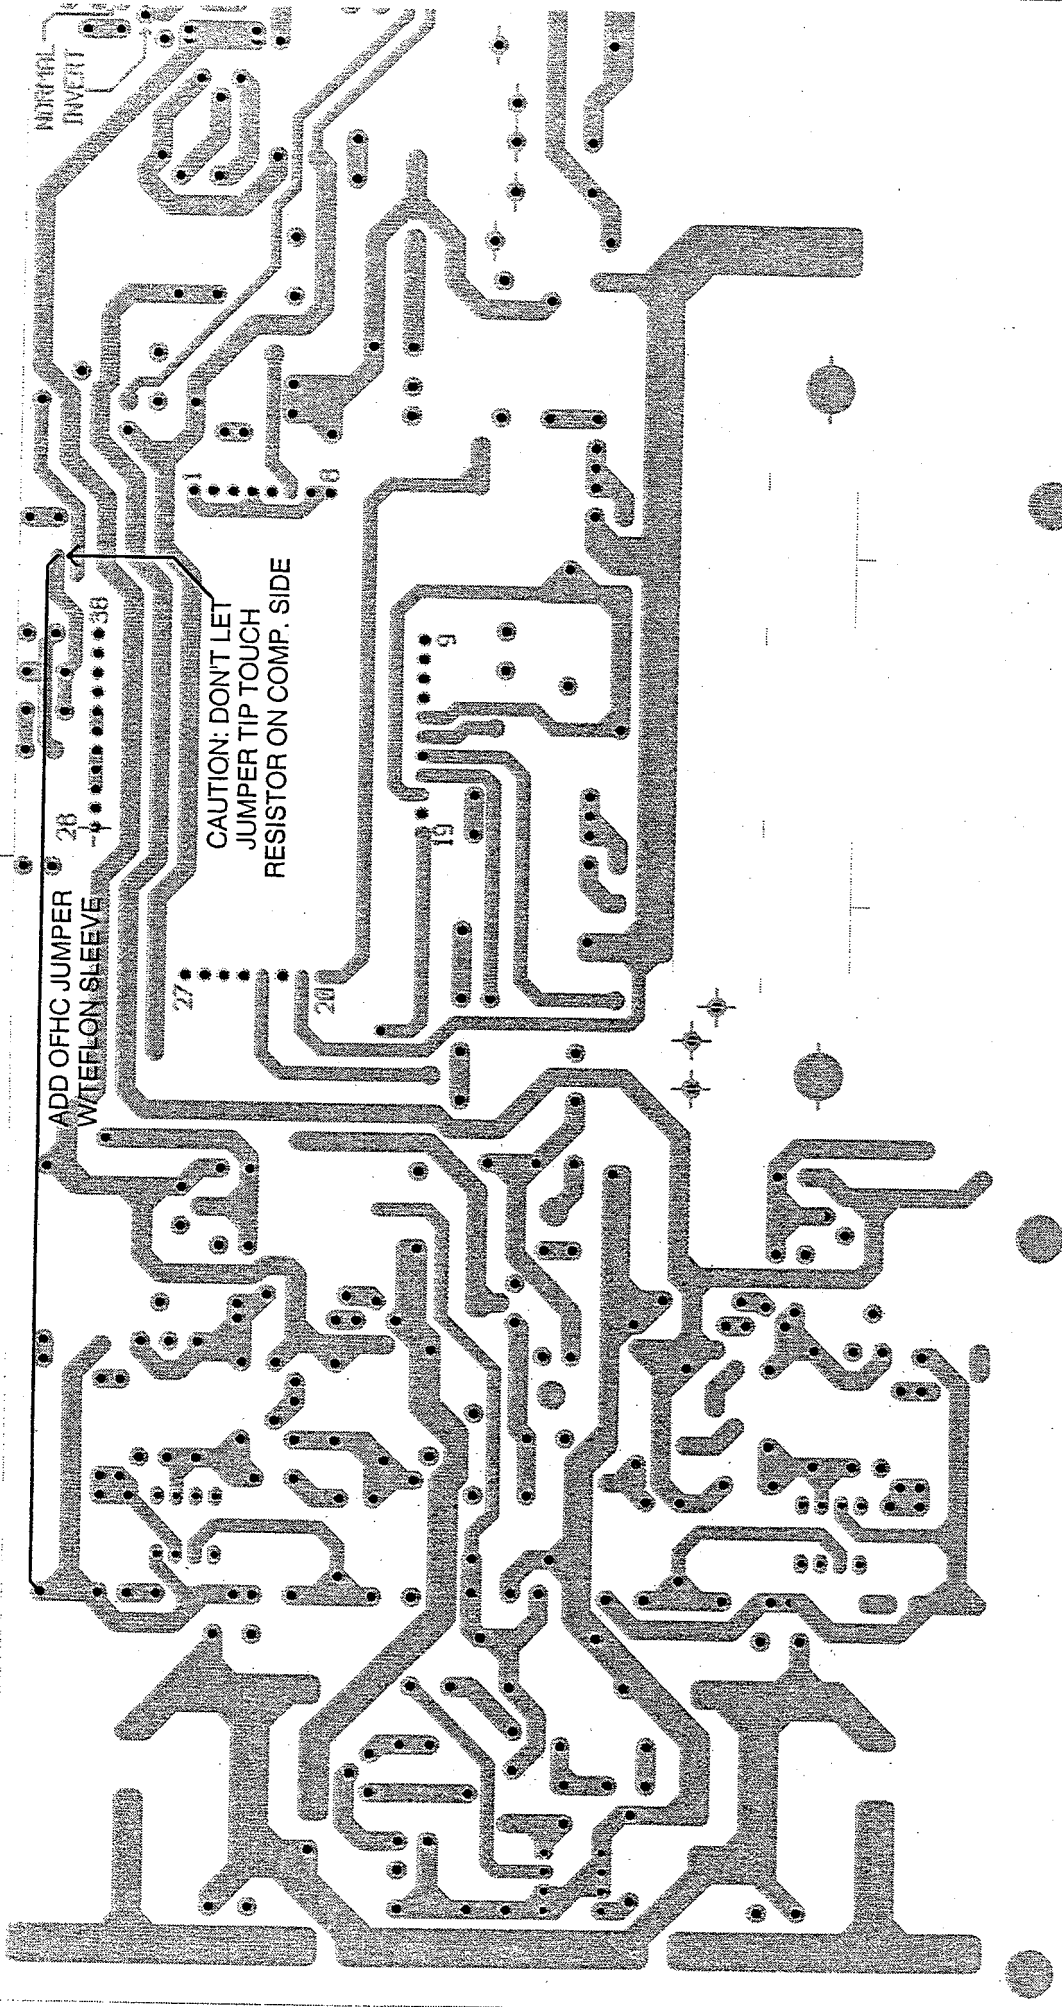

150M REV2
PWB636E SOLDER SIDE
1-8-03